


Key Finding #4

The influx was not recognized until hydrocarbons were in the riser

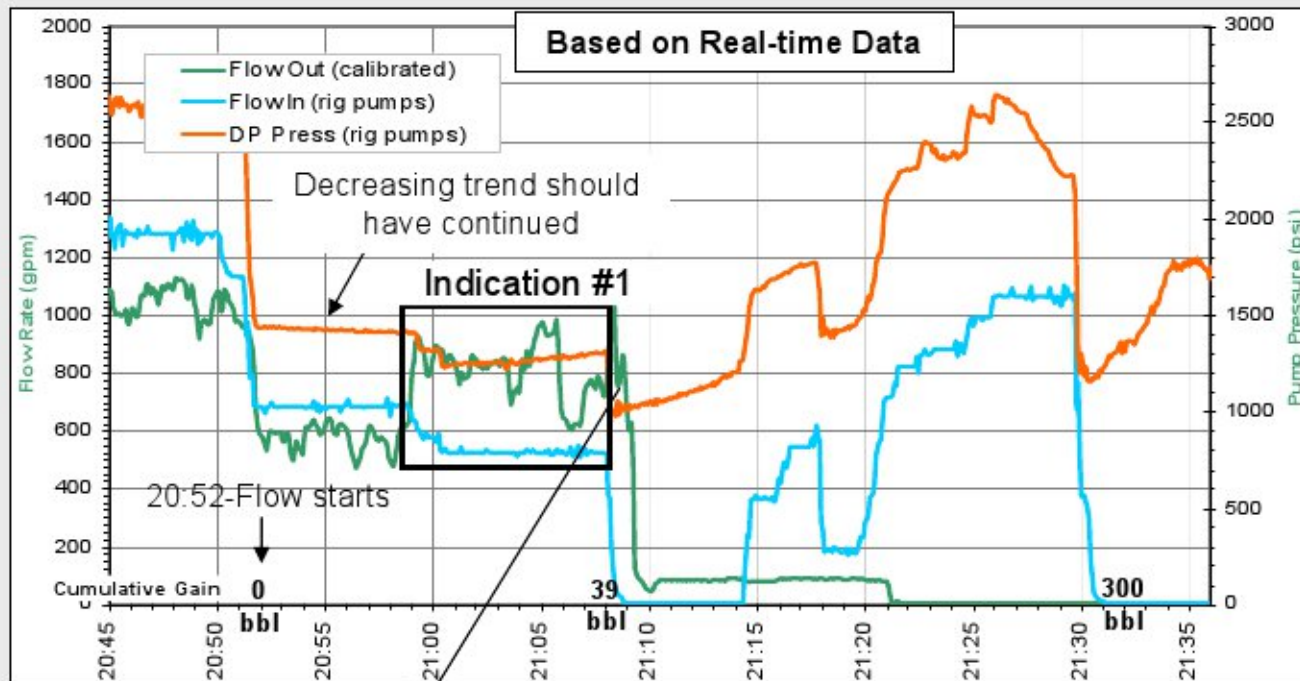

Flow indications:

- #1: Drill pipe pressure increased by 100 psi, (expected decreased); ~39 bbl gain from 20:58 to 21:08

