


Evidence Supports Force From Above Being Transmitted to Drill Pipe Below BSR

Heavier erosion at likely second VBR seal

Lighter erosion at likely first VBR seal

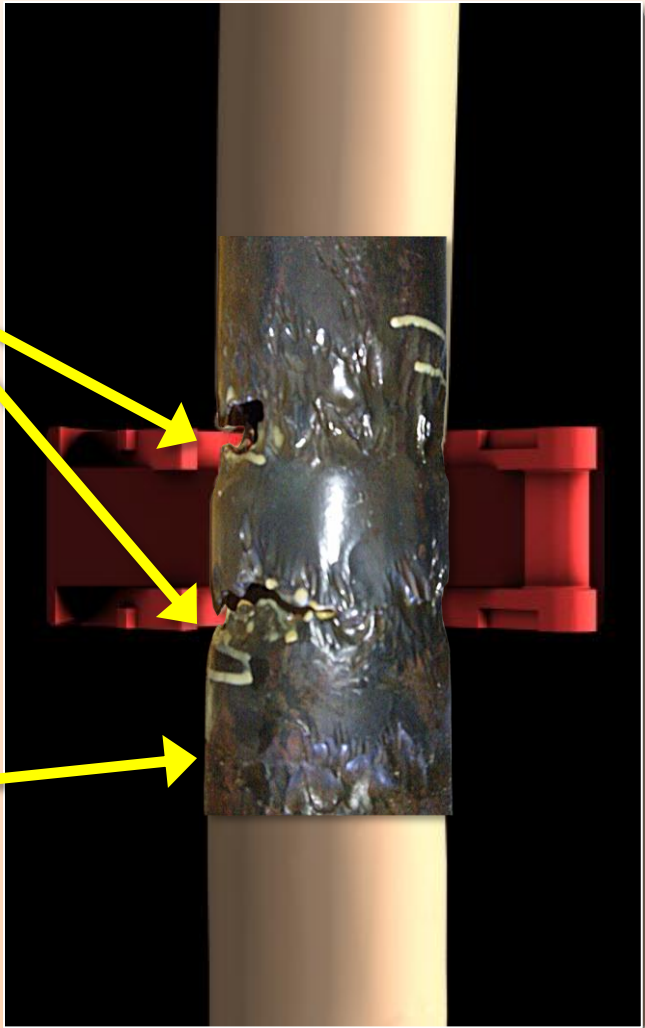

Segment 148: Showing erosion patterns where contacted upper VBR

